









Model Number


RL28-8-H-400-IR/47/105

Background suppression sensor with 5-pin, M12 x 1 plastic connector


Features

- Ultra bright LEDs for power on and switching state
- Minimal black/white difference through the infrared transmission LED
- Not sensitive to ambient light, even with energy saving lamps
- Waterproof, protection degree IP67
- Protection class II

Dimensions

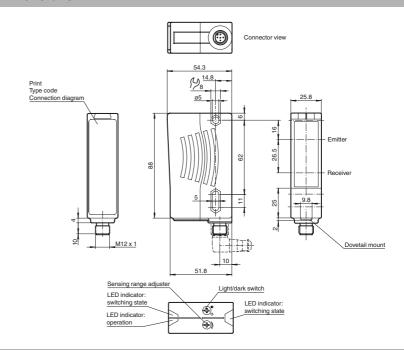

Electrical connection

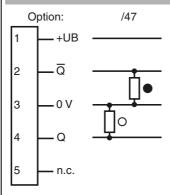

- O = Light on
- = Dark on

Pinout



www.pepperl-fuchs.com

General specifications		
Detection range		20 400 mm
Detection range min.		20 150 mm
Detection range max.		20 400 mm
Light source		IRED
Light type		modulated infrared light , 880 nm
Black/White difference (6 %/9	0 %)	< 5 %
Diameter of the light spot	.0 ,0,	approx. 14 mm at a distance of 400 mm
Angle of divergence		transmitter 2°
g · - · · · · · · · · · · · · · · ·		receiver 2°
Ambient light limit		50000 Lux
Functional safety related par	ameters	
MTTF _d		1130 a
Mission Time (T _M)		20 a
Diagnostic Coverage (DC)		0 %
Indicators/operating means		
Operating display		LED green
Function display		2 LEDs yellow
, and an aleptay		ON: object inside the scanning range OFF: object outside the scanning range
Controls		Light/Dark switch
Controls		Detection range adjuster
Electrical specifications		
Operating voltage	U_{B}	10 30 V DC
Ripple		10 %
No-load supply current	I ₀	≤ 40 mA
Output		
Switching type		light/dark on switchable
Signal output		2 PNP, complementary, short-circuit protected, reverse pola protected , open collectors
Switching voltage		max. 30 V DC
Switching current		max. 200 mA
Switching frequency	f	250 Hz
Response time		2 ms
Ambient conditions		
Ambient temperature		-40 60 °C (-40 140 °F)
Storage temperature		-40 75 °C (-40 167 °F)
Mechanical specifications		
Protection degree		IP67
Connection		M12 x 1 connector, 5-pin
Material		
Housing		Plastic ABS
Optical face		plastic
Connector		plastic
Mass		70 g
Compliance with standards a ves	and direct	•
Standard conformity		
Product standard		EN 60947-5-2:2007
Approvals and certificates		
Protection class		II, rated voltage ≤ 250 V AC with pollution degree 1-2 according to IEC 60664-1
CCC approval		Products with a maximum operating voltage of ≤36 V do not bear a CCC marking because they do not require approval

Accessories

OMH-05

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-21

Mounting bracket

OMH-22

Mounting bracket

OMH-MLV11-K

dove tail mounting clamp

OMH-RLK29

Mounting bracket

OMH-RLK29-HW

Mounting bracket for rear wall mounting

OMH-RL28-C


Protective cover


Other suitable accessories can be found at www.pepperl-fuchs.com

EPPERL+FUCHS

bear a CCC marking because they do not require approval.

Curves/Diagrams

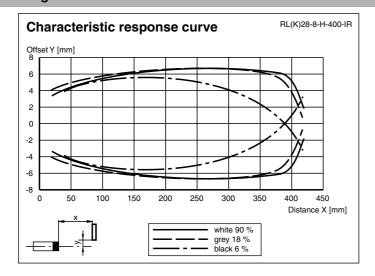

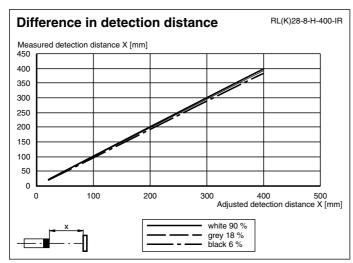

Additional information

Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

Mounting instructions:

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

Adjustment:

After the operating voltage is applied, the LED is lit green.

USA: +1 330 486 0001

fa-info@us.pepperl-fuchs.com

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

Object direction:

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.

421202 eng.xml

2011-12-21

Date of issue: