











## **Model Number**


# RL28-8-H-400-IR-Z/47/112

Background suppression sensor with metal connector M12; 5-pin, 90° convertible


### **Features**

- Ultra bright LEDs for power on and switching state
- Minimal black/white difference through the infrared transmission LED
- Programmable time function GAN, GAB, IAB and GAN-IAB as double function
- Not sensitive to ambient light, even with energy saving lamps
- Waterproof, protection degree IP67

## **Dimensions**

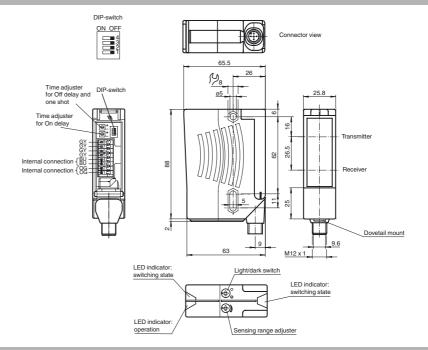

## **Electrical connection**

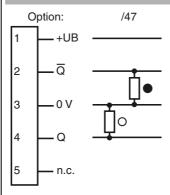

- O = Light on
- = Dark on

## **Pinout**



#### **Technical data** General specifications Detection range 20 ... 400 mm Detection range min. 20 ... 150 mm 20 ... 400 mm Detection range max Background suppression max. + 10 % of the upper limit of the detection range IRFD Light source Light type modulated infrared light, 880 nm Black/White difference (6 %/90 %) < 5 % Diameter of the light spot approx. 14 mm at a distance of 400 mm Angle of divergence transmitter 2° receiver 2° 50000 Lux Ambient light limit Functional safety related parameters 1130 a Mission Time (T<sub>M</sub>) 20 a Diagnostic Coverage (DC) 0 % Indicators/operating means LED green Operating display Function display 2 LEDs yellow ON: object inside the scanning range OFF: object outside the scanning range Controls Light/Dark switch Controls Detection range adjuster **Electrical specifications** 10 ... 30 V DC Operating voltage Ripple 10 % ≤ 40 mA No-load supply current Output Switching type light/dark on, switchable (selectable, light/dark switching is only activated if the receiver has 'dark on' selected.) 2 PNP, complementary, short-circuit protected, reverse polarity Signal output protected, open collectors max. 30 V DC Switching voltage max. 200 mA Switching current Switching frequency 250 Hz Response time 2 ms Timer function ON delay (GAN), OFF delay (GAB), one shot (IAB), ON delayone shot (GAN-IAB), programmable adjustment interval 0.02 s ... 1 s **Ambient conditions** Ambient temperature -40 ... 60 °C (-40 ... 140 °F) Storage temperature -40 ... 75 °C (-40 ... 167 °F) Mechanical specifications IP67 Protection degree Connection 5-pin, M12 x 1 connector, 90° rotatable Material Plastic ABS Housing Optical face plastic Connector metal approx. 100 g Mass Compliance with standards and directives Standard conformity FN 60947-5-2:2007 Product standard Approvals and certificates UL approval CCC approval Products with a maximum operating voltage of ≤36 V do not

#### **Accessories**

#### **OMH-05**

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

#### **OMH-21**

Mounting bracket

#### **OMH-22**

Mounting bracket

### OMH-MLV11-K

dove tail mounting clamp

#### OMH-RLK29

Mounting bracket

#### OMH-RLK29-HW

Mounting bracket for rear wall mounting

#### OMH-RL28-C

Protective cover


Other suitable accessories can be found at www.pepperl-fuchs.com


PEPPERL+FUCHS

www.pepperl-fuchs.com


bear a CCC marking because they do not require approval.

## **Curves/Diagrams**

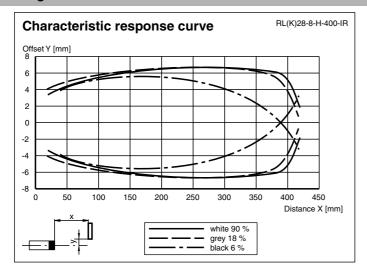

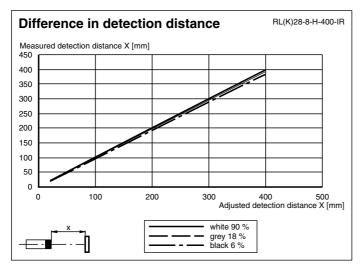

## **Timer functions**

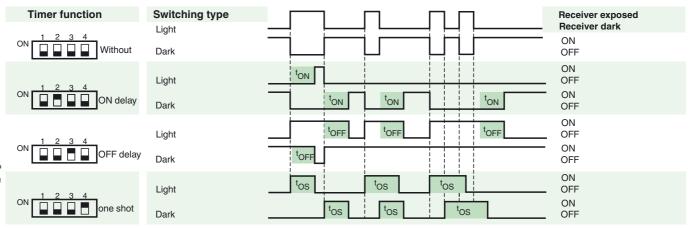

Time  $t_{ON}$ ,  $t_{OFF}$  and  $t_{OS}$  are adjustable from 0.02 to 1 seconds. The Light-/Dark-Switch (Left, outer switch) is shown in the "Dark ON" position.

Туре	Description	Notes
-Z	OFF delay timer	Adjustable time interval
	one shot timer	(0.02 s - 10 s)
	ON delay timer	
	ON delay timer / OFF delay timer	1
	ON delay timer / one shot timer	

Germany: +49 621 776-4411

fa-info@pepperl-fuchs.com

Pepperl+Fuchs Group www.pepperl-fuchs.com 3

## **Additional information**

### Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

## Mounting instructions:

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

#### Adjustment:

After the operating voltage is applied, the LED is lit green.

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

### **Object direction:**

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

## Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.