









Model Number

RL28-8-H-2000-IR/47/105/106

Background suppression sensor with 5-pin, M12 x 1 plastic connector


Features

- Universal series with highly versatile fields of use
- Resistant against noise: reliable operation under all conditions
- Minimal black/white difference through the infrared transmission LED
- · Version with heated front panel


Product information

The series 28 family of sensors can be universally used. It has a large range of models that allows it to be integrated into any automation environment. The sensors are contained in sturdy water resistant plastic housings with multiple fastening options and scratch resistant optical cover. Features such as a timer function, and functions including a light/dark switch, sensitivity adjuster and highly visible status LEDs make for less effort on the part of the user and streamline installation, setup and operation. Just about any task associated with positioning, moving, conveying and monitoring can be accomplished with these sensors.

Dimensions

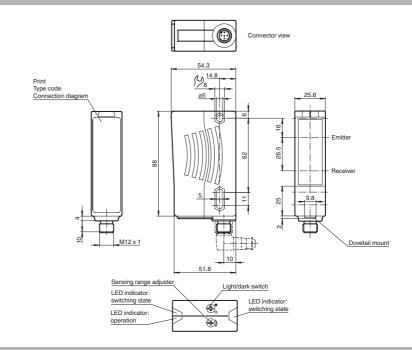

Electrical connection

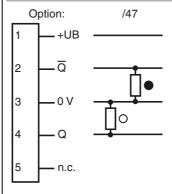


- O = Light on
- = Dark on

Pinout



Indicators/operating means

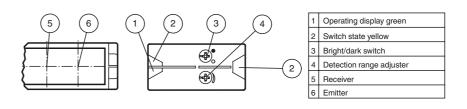

Technical data General specifications 20 ... 2000 mm Detection range Detection range min. 20 ... 200 mm Detection range max 20 ... 2000 mm Background suppression max. + 10 % of the upper limit of the detection range **IRED** Light source Light type modulated infrared light, 880 nm Black/White difference (6 %/90 %) < 40 % Diameter of the light spot approx. 70 mm at a distance of 2000 mm Angle of divergence transmitter 2° receiver 2° 50000 Lux Ambient light limit Functional safety related parameters 1130 a Mission Time (T_M) 20 a Diagnostic Coverage (DC) 0 % Indicators/operating means LED green Operating display Function display 2 LEDs yellow ON: object inside the scanning range OFF: object outside the scanning range Controls Light/Dark switch Controls Detection range adjuster **Electrical specifications** 24 V DC ± 20 % Operating voltage Ripple 10 % ≤ 75 mA No-load supply current Output Switching type light/dark on switchable Signal output 2 PNP, complementary, short-circuit protected, reverse polarity protected, open collectors Switching voltage max. 30 V DC Switching current max. 200 mA Switching frequency 250 Hz Response time 2 ms **Ambient conditions** Ambient temperature -40 ... 60 °C (-40 ... 140 °F) Storage temperature -40 ... 75 °C (-40 ... 167 °F) Mechanical specifications Protection degree IP67 Connection M12 x 1 connector, 5-pin Material Housing Plastic ABS Plastic pane Optical face Heated lens Note Compliance with standards and directives Low Voltage Directive 2006/95/EC Directive conformity EMC Directive 2004/108/EC Standard conformity Product standard EN 60947-5-2:2007 IEC 60947-5-2:2007 Approvals and certificates Protection class II, rated voltage ≤ 250 V AC with pollution degree 1-2 according to IEC 60664-1 UL approval cULus Listed, Class 2 power source CCC approval Products with a maximum operating voltage of ≤36 V do not

Accessories

OMH-05

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

Mounting aid for round steel ø 12 mm or sheet 1.5 mm ... 3 mm

OMH-21

Mounting bracket

OMH-22

Mounting bracket

OMH-MLV11-K

dove tail mounting clamp

OMH-RLK29

Mounting bracket

OMH-RLK29-HW

Mounting bracket for rear wall mounting


OMH-RL28-C

Weld slag cover model

Other suitable accessories can be found at www.pepperl-fuchs.com

fa-info@sg.pepperl-fuchs.com

bear a CCC marking because they do not require approval.

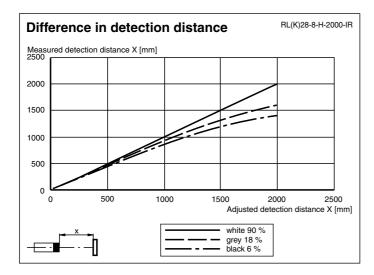

Additional information

Intended use:

The transmitter and receiver are located in the same housing for direct detection sensors with background masking. Marking of objects outside the detection range is achieved by arranging the angle between the transmitter and receiver (2 receiver elements).

Objects are detected independently of their surface structures, brightness and colour, as well as the brightness of the background.

Mounting instructions:

The sensors can be fastened directly with fixing screws or with a support bracket (not included with delivery).

The surface underneath must be flat to prevent the housing from moving when it is tightened into position. We recommend securing the nut and screw in place with spring washers to prevent the sensor from going out of adjustment.

Adjustment:

After the operating voltage is applied, the LED is lit green.

fa-info@us.pepperl-fuchs.com

Align the sensor to the background. If the yellow LED is lit, the detection range should be reduced with the detection range adjuster until the yellow LED goes out.

Object direction:

Place the object to be detected at the desired maximum detection range and align the light spot to it. If the object is detected, the yellow LED lights up.

If it does not light up, the detection range must be adjusted on the potentiometer until it lights up when an object is detected.

Cleaning:

We recommend cleaning the optical surface and checking the screwed connection and other connections at regular intervals.

183415_eng.xml